

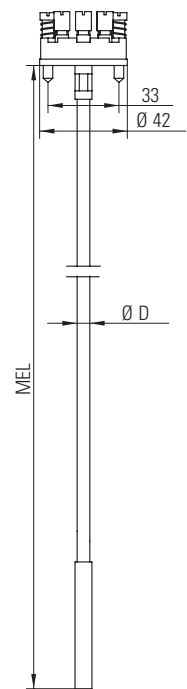


Measuring inserts for resistance thermometers

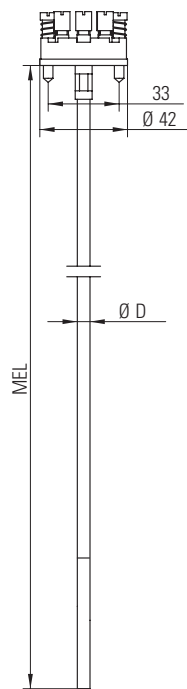

Measuring inserts as spare part or independent assembly group for installation in protection tubes

- Measuring tube and mineral-insulated cable at stainless steel
- With direct insertion in the media only for low mechanical loads
- Mounting screws with spring
- Connection by ceramic block with bush terminals

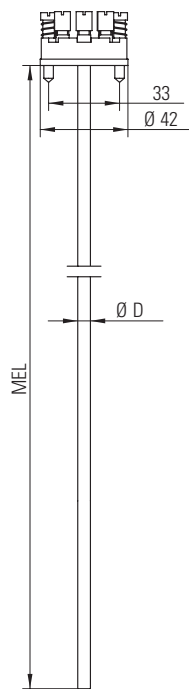

Type	WT-ME Rigid protection tube	WT-ME-MI-D Flexible mineral-insulated cable, rigid probe	WT-ME-MI-S Flexible mineral-insulated cable, rigid probe
Diameter (mm)		6/8	
Length MEL (mm)		100...2.000	
Measuring range (°C)		-100 to +500	
Connection	Ceramic block with bush terminals		
Sensor type and wire connection	Pt 100 for 2-, 3- or 4-wire connection; single or twin		
Accuracy class (acc. to DIN EN 60751)	B		